

PHYWE Systeme GmbH & Co. KG  
Robert-Bosch-Breite 10  
D-37079 Göttingen

Telefon +49 (0) 551 604-0  
Fax +49 (0) 551 604-107  
E-mail info@phywe.de  
Internet www.phywe.com

## Operating instructions




Fig. 1: 12921-00 Cobra SMARTsense pH 0... 14

## TABLE OF CONTENTS

|    |                                   |
|----|-----------------------------------|
| 1  | SAFETY PRECAUTIONS                |
| 2  | PURPOSE AND CHARACTERISTICS       |
| 3  | FUNCTIONAL AND OPERATING ELEMENTS |
| 4  | NOTES ON OPERATION                |
| 5  | HANDLING                          |
| 6  | TECHNICAL DATA                    |
| 7  | SCOPE OF DELIVERY                 |
| 8  | ACCESSORIES                       |
| 9  | CONFORMITY                        |
| 10 | DISPOSAL                          |

## 1 SAFETY PRECAUTIONS



### Caution!

- Carefully read these operating instructions completely before operating this instrument. This is necessary to avoid damage to it, as well as for user-safety.
- Only use the instrument for the purpose for which it was designed.
- Only use the instrument in dry rooms in which there is no risk of explosion.
- Protect the instrument from dust, moisture and vapours. Use a slightly moist lint-free cloth to clean the instrument. Do not use aggressive cleaning agents or solvents.
- Take care that no liquid penetrates in through the housing openings, as such penetration would result in damage to Sensor.

## 2 PURPOSE AND CHARACTERISTICS

The sensor is used for measuring pH values and for transferring the values to a terminal device, e.g. a tablet computer, smartphone, etc., via Bluetooth.

### 3 FUNCTIONAL AND OPERATING ELEMENTS

#### 3.1 Operating elements

The sensor has an on-button and two LEDs for indicating the Bluetooth and battery charge status.

##### On-button

Press the on-button for more than 3 seconds to switch the sensor on and off

##### Bluetooth-LED

|                                |                                  |
|--------------------------------|----------------------------------|
| Flashing red every 2 seconds   | Not connected                    |
| Flashing green every 2 seconds | Connected to the terminal device |
| Flashing green every 4 seconds | Running measurement              |

##### Battery charge LED

|                              |             |
|------------------------------|-------------|
| Flashing red every 5 seconds | Low battery |
|------------------------------|-------------|

#### 3.2 Measurement inputs

The face of the sensor has a BNC connector to which the supplied pH electrode can be connected.

### 4 NOTES ON OPERATION

This device fulfils all of the technical requirements that are compiled in current EC guidelines. The characteristics of this product qualify it for the CE mark.

The individual connecting leads are each not to be longer than 2 m.

The instrument can be so influenced by electrostatic charges and other electromagnetic phenomena (HF, bursts, indirect lightning discharges) that it no longer works within the given specifications. Carry out the following measures to reduce or eliminate the effect of such disturbance: Ensure potential equalization at the PC (especially with Laptops). Use screening. Do not operate high frequency emitters (e.g. radio equipment or mobile radiotelephones) in the immediate vicinity. When a total failure of the instrument occurs, unplug it and plug it back in again for a reset.

### 5 HANDLING

This section describes the start-up of the sensor and the recording of measurement data. Please read this section thoroughly in order to avoid failures or operating errors.

#### 5.1 Start-up

Switch the sensor on by pressing the on-button for more than 3 seconds. The Bluetooth LED lights up red. Start the measureApp application and select the sensor.

There is a 9-digit code on the back of the sensor (Fig.2). The last 4 digits of the code are displayed as the sensor name in the software (Fig.3). This enables the precise assignment of the sensors within the software.



Fig. 2

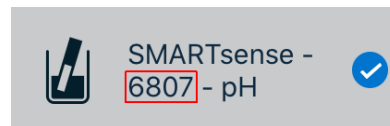


Fig. 3

Connect the supplied pH electrode to the BNC connector of the sensor.

#### 5.2 Measurement of pH values

To measure the pH value of a medium, the pH electrode at the measuring head must be completely immersed into the medium. If a whole series of different solutions is to be measured, we recommend rinsing the pH electrode in between the measurements with pure water and to shake the water off carefully in order to prevent the contamination of the next sample with the residues of the previous one. If absolute pH values are to be measured, the pH electrode should be calibrated beforehand, e.g. with the pH 4 buffer tablets (ref. no. 30281-10) and with the pH 10 buffer tablets (ref. no. 30283-10). The solution should always remain slightly in motion during the measurement. This can be realised by stirring the liquid with a magnetic stirrer or similar or by moving the measuring probe carefully to and fro.

#### 5.3 Maintenance and cleaning of the measuring probe

Please observe the maintenance and care instructions of the pH electrode. Notes concerning outdoor use: We recommend calibrating the pH electrode at the laboratory with buffer tablets or a buffer solution prior to executing the outdoor experiment. When preparing the buffer solution with buffer tablets, use 20 ml of distilled water. While a 3 M KCl solution should be used for the long-term storage of the pH electrode, the electrode for outdoor measurements in the protective sheath (ref. no. 37651-15) can be stored briefly in tap water. Do not use distilled water for storage! Do not allow the pH electrode to dry completely!

#### 5.4 Replacing the battery

##### Remove the battery

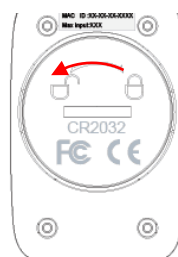


Fig. 4

Open the sensor by turning the screw cap on the back of the sensor counterclockwise e.g. with a coin.

Carefully lift the battery out of its socket with the aid of a small screwdriver or small scissors. Insert the screwdriver as shown in Fig. 5.



Fig. 5

## Insert new battery

Slide the battery under the golden metal nose (Fig.6-1). Make sure that the battery is completely under the metal nose and is pushed completely to the upper edge.

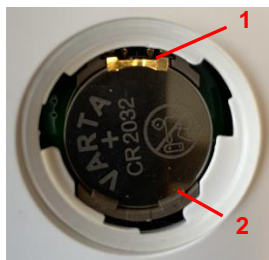


Fig. 6

Press the battery into the socket by applying light pressure on the opposite side.

The battery slides under the two plastic lugs (Fig. 6-2), which can also be noticed by a short "click".



Fig. 7

Before closing the lid, make sure that the seal in the lid is not bent and lies cleanly on the edge of the lid. After closing, turn the lid clockwise to tighten it.

## 6 TECHNICAL DATA

Operating temperature range: 5 - 40°C  
Rel. humidity < 80%

|                                     |                 |
|-------------------------------------|-----------------|
| Measuring range                     | pH 0... 14      |
| Resolution                          | 0.01 pH         |
| Max. data transfer rate             | 100 Hz          |
| Battery type                        | CR2032          |
| Max. wireless range (open field)    | 30 m            |
| Dimensions (width x height x depth) | 90 x 44 x 23 mm |
| Weight                              | 42 g            |

## 7 SCOPE OF DELIVERY

- The extent of delivery is as follows
- Cobra SMARTsense pH 12921-00
- pH-electrode
- Operating instructions

## 8 ACCESSORIES

The following accessories are available:

- Button Cell CR2032, 3V 07922-15
  - pH-Electrode; BNC 46265-15
  - Buffer solution tablets, pH 4 30281-10
  - Buffer solution tablets, pH 7 30282-10
  - Buffer solution tablets, pH 10 30283-10
  - Buffer solution, pH 4,01, 1000 ml 46270-12
  - Buffer solution, pH 4,62, 1000 ml 30280-70
  - Buffer solution, pH 7,01, 1000 ml 46271-12
  - Buffer solution, pH 9,00, 1000 ml 30289-70
  - Buffer solution, pH 10,01, 1000 ml 46272-12
- Storage flask for pH electrodes, filled with

250 ml 3.0 M KCl solution

18481-20

- Free measureApp available from supplier portals

iOS



Android



Windows



## 9 CONFORMITY



PHYWE Systeme GmbH & Co.KG hereby declares that the radio system type 12921-00 complies with the 2014/53/EU directive. The complete text of the EC Declaration of Conformity is available at the following Internet address:  
[www.phywe.com/en/ec-declaration](http://www.phywe.com/en/ec-declaration)

## 10 DISPOSAL

The packaging mainly consists of environmentally-friendly materials that should be returned to the local recycling stations.



Do not dispose of this product with normal household waste. If this unit needs to be disposed of, please return it to the address that is stated below for proper disposal

PHYWE Systeme GmbH & Co. KG  
Abteilung Kundendienst  
Robert-Bosch-Breite 10  
D-37079 Göttingen

Telefon +49 (0) 551 604-274  
Fax +49 (0) 551 604-246